

Photo Report

MP-OPN-06, Rev No:A

Messr.

Job No. : 3206/C0005

Date : 7th June, 2018

Location : Yantian Terminal, China

Subject: Damaged Hatch Cover Structure Renewal

Damaged part:




1. Marked the repair area as pre repair plan.



- a. deck plate 400mm*1850mm*10mm thk DH36
- b. vertical web 100mm*2000mm*10mm thk DH36
- c. gutter plate F. bar 65mm*2000mm*12mm thk
- d. bracket 150mm*200mm*10mm thk DH36

2. Cropped off damaged structure and prepared to fitting.

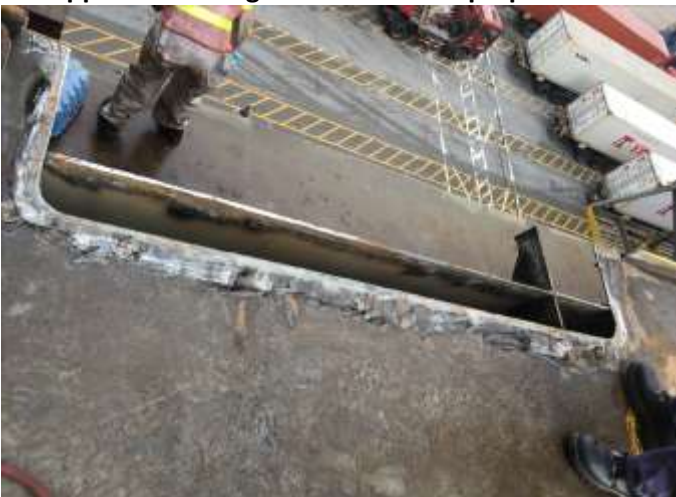

3. Refit new steel plate.

HSD MARINE AND SHIPREPAIR PTE LTD

(Ship Repair, Maintenance and Stores/Spares Supply in Singapore, China and India / Ports, Anchorage, Afloat / Worldwide Voyage Repairs)



4. Completed welding and grinding.



5. During heavy raining after completing the job, NDT was not carried out. After a little long time, no leaking was found under deck.